



## SOFTWARE PATCH RELEASE NOTES

---

Release date                      November 25, 2008                      *Supersedes version #* 1.13.5069  
Software version                      1.13.5108                      (*PC/MAC version #* )1.13.5069  
Firmware version                      [S3/I3/S1:448,M1: 438]                      *Released on* 26 Sept, 2008  
Library Version                      3.14.2

Build Type	MD5 Checksum	File Size
<b>MAC</b>	f107370dd4388a53888ca489386d2e4d	46.3 MB
<b>PC</b>	d8078080d14149707c310560d8b43e69	35.1 MB
<b>Console</b>	d8ace4b99656997235a34ed6bea7d238	21.0 MB

### Important Information

---

***This patch release is to address the bugs below and provides an updated fixture library. The new fixtures can be found in the library marked "New".***

Please report issues with this software to [support@jandsvista.com](mailto:support@jandsvista.com)

### Bugs fixed in this release

---

ID	Summary
2396	Audio glitches when playing clip back on I3
2456	Stage goes to black after discarding changes
2464	Crash on clip with random chase
2466	DMX break on M1 too low

## Fixtures added in this release

---

### Manufacturer

### Model

AC Lighting	ChromaQ (24 frame) Color Punch Mode 3
Acclaim	X-Eye-HP X-Eye X-Panel 1 RGB X-Panel 25 RGB
American DJ	Accu Spot 575 16 bit Accu Spot 575 8 bit
Brother Brother	EvenLED 16bit EvenLED 8bit
Chauvet	Colorado 1 ARC mode Colorado 1 ARCd mode Colorado 1 Stage mode Colorado Batten 80i Arc 1 + D Colorado Batten 80i Arc 1 Colorado Batten 80i Arc 2 + D Colorado Batten 80i Arc 2 Colorado Batten 80i Block 1 Colorado Batten 80i Block 2 Colorado Batten 80i Block 3 Colorado Batten 80i Block 4 Colorado Batten 80i HSV Colorado Batten 80i Pixel 1 Colorado Batten 80i Pixel 2 Colorado Batten 80i Stage 1 Colorado Batten 80i Stage 2 Colorado Panel Arc 1 + D Colorado Panel Arc 1 Colorado Panel Arc 2 + D Colorado Panel Arc 2 Colorado Panel HSV Colorado Panel Stage 1 Colorado3 Mode 2
ColorKey	LED Par 64 10mm (6ch) LED Par 64 1w (6ch)
Elation	Active Scan 250 DLED-60 (63ch) DLED-60 (6ch) Design Spot 300E ELED Tri64B 1 channel ELED Tri64B 2 channel ELED Tri64B 3 channel ELED Tri64B 4 channel ELED Tri64B 6 channel ELED Tri64B 7 channel
Expolite	TourLED 36.wp ARC mode TourLED 36.wp ARCd mode TourLED 36.wp Stage mode

Jands Vista Software Patch Release 1.13.5108 Patch Release Notes  
November 25, 2008

Jands Pty Ltd, 40 Kent Rd, Mascot, NSW, 2020, Australia  
Phone: +61 (2) 9582 0909 Fax: +61 (2) 9582 0999 Web: [www.jandsvista.com](http://www.jandsvista.com)

Page 2 of 9

Generic	Dimmer - 16 bit
IPIX	Satellite 5 ch Satellite 6 ch
Lanling	L2600
Martin	Mac 700 Wash Basic (v2) Mac III Profile 16 bit Basic Mac III Profile 16 bit Extended RGB Laser 1.6
Mega Stage	MegaBlast RGB
Microh	Blazer 100 Blazer 250R Cyclops 150R Mode 1 Cyclops 150R Mode 2 Cyclops 150R Mode 3 Cyclops 150R Mode 4 Profile Spot PZM
Pasef	Sky Tracker
Robe	ColorWash 2500E AT Mode 1 ColorWash 2500E AT Mode 2 2500E AT Mode 3 ColorWash 2500E AT Mode 4 ColorWash 2500E AT Mode 5 Digital Spot 3000DT v1.1 - Gobo layer channels Digital Spot 3000DT v1.1 - No Server Mode Digital Spot 3000DT v1.1 - Server master channels Digital Spot 7000DT v1.1 - Gobo layer channels. REDFlash 3.192 Mode 1 REDFlash 3.192 Mode 2 REDFlash 3.192 Mode 3 REDFlash 3.192 Mode 4 REDStrobe 3.192 Mode 1 REDStrobe 3.192 Mode 2
Roblon	FL 75 XT-2C Colour wheel FL 75 XT-2C Dimmer wheel FL 75 XT-2C Dual wheel
Showtec	Phantom 250 Spot Advanced Phantom 250 Spot Basic Space Tracer 4000
Stage Technologies	F_light
Vari*Lite	VL6C + DPP Mode 10 VL6C + DPP Mode 5 VL6C + DPP Mode 6 VL6C + DPP Mode 7 VL6C + DPP Mode 8

Jands Vista Software Patch Release 1.13.5108 Patch Release Notes  
November 25, 2008

Jands Pty Ltd, 40 Kent Rd, Mascot, NSW, 2020, Australia  
Phone: +61 (2) 9582 0909 Fax: +61 (2) 9582 0999 Web: [www.jandsvista.com](http://www.jandsvista.com)

Page 3 of 9

	VL6C + DPP Mode 9 VL6C Mode 10 VL6C Mode 5 VL6C Mode 6 VL6C Mode 7 VL6C Mode 8 VL6C Mode 9
Vincent	LedLine 1206 LedLine 306 LedLine 606 LedLine 906
Wild Fire	EM-2D EM-4D
Wybron	CXI Scroller Index Mode Mspeed disabled CXI Scroller Index Mode Mspeed Coloram II (16 gel) (dh)

All new fixtures can be found in the "New" library of the Jands Vista application.

## Fixtures repaired in this release

---

Manufacturer	Model
Elation	PowerSpot575IE(v2) Vision 575
Martin	Mac700

All repaired fixtures can be found in the "New" library of the Jands Vista application.

---

## Known Issues

---

The issues listed here are known issues with Vista. These issues may or may not be resolved in a future release of Vista software.

Additional reports on these or any other issues are welcome, or for more information please contact Jands.

Each issue is broken down as follows:

- An ID that Jands uses to track the issue followed by a summary
- The Description field provides more details about the issue
- The Workaround field may give you additional information about how you can work around that particular issue. If it says "None" there is no currently suggested workaround for that particular problem.

### **1736** Non-administrator accounts can't save user preferences on Vista App for Windows

**Description** When running Vista on a Windows XP machine where you are not logged in as the administrator it will not let you change any user preferences settings – an error dialog appears saying "Cannot save user preferences".

**Workaround** None available. Note that non-administrators cannot install Vista App for Windows.

### **1973** Inability to fade from raw->generic values

**Description** It is not possible to transition from a raw setting to a generic setting - the generic fixture model only operates in one direction. This manifests when (for example) you first use the generic controls to setup a base colour, then apply a raw transparent ColorFX preset over the top of that (the colour will track through) then you apply another generic colour over the ColorFX preset (the preset will not track through and the channel will return to default).

**Workaround** If the ColorFX preset is applied from a separate clip running at a higher priority, then it will always be the last link in the chain and the transition will work properly.

### **1979** Can't see Ether-Lynx from Vista PC after running DMX-Workshop

**Description** If you have Artistic Licence DMX-Workshop running, VistaPC doesn't see the Ether-Lynx connected either via crossover cable or through a network.

**Workaround** Close DMX-Workshop and restart the Vista application. If that doesn't work, it's possible that DMX-Workshop did not start/stop cleanly and so is still running a process - open task manager and kill the process and then restart the Vista application.

Jands Vista Software Patch Release 1.13.5108 Patch Release Notes  
November 25, 2008

Jands Pty Ltd, 40 Kent Rd, Mascot, NSW, 2020, Australia  
Phone: +61 (2) 9582 0909 Fax: +61 (2) 9582 0999 Web: [www.jandsvista.com](http://www.jandsvista.com)

Page 5 of 9

## Installing UD512 USB>DMX Device

---

This software update includes changes to the Vista UD512 USB>DMX device driver. To install the device correctly, please follow the instructions below:

1. Remove any UD512 devices from the computer
2. Install the Vista software as normal. Please ensure **all** boxes are ticked in the "Choose components" dialogue
3. Connect a UD512 to your computer. You should see:
  - The blue LED within the UD512 flash a couple of times then stay off
  - The Windows "Found new hardware" wizard appear
4. The Found New Hardware wizard will ask "Can Windows connect to Windows Update to search for software?". Select "No, not this time", and click Next
5. You will be asked "What would you like the wizard to do?". Select "Install from a list or specific location (advanced)", and click Next
6. You will be asked "Please choose your search and installation options". Select "Don't search. I will choose the driver to install", and click Next
7. You will see a list titled "Select the driver you want to install for this hardware". Select "Vista UD512" from the list, and press Next
8. The new drivers should now install. Once Windows is finished installing the drivers, click Finish.

Some users have found that if the UD512 was not uninstalled before commencing the upgrade process, then the installation wizard will not appear.

To resolve this issue:-

1. Open the Windows Device Manager.
2. Locate the driver under "USB Controllers.
3. Right click on "Update driver". This will start the installation wizard.
4. Follow the procedure listed above.

# Accessing Files for Archiving and Export

---

## Application

Before updating the console, Jands recommends that all users archive all show data. This process describes the procedure to be followed to access show files that are on the Vista T4, T2, and I3 console hard drives.

There are two methods to access show files and other data – Export via USB and File Transfer Protocol (FTP).

## Archiving and Exporting Files via USB


### Parts Required

- USB Stick of an appropriate size. This will be determined by the amount of data to be archived or exported.

### Procedure

1. Start the console in the normal manner.
2. Once the console has completed the boot up sequence, insert a USB disk. The slot in the armrest is recommended because of ease of access.
3. On the console, open the "Vista" Menu.
4. Select "Export".
5. Select "USB" (as illustrated in Figure 1).

Figure 1 - Vista Menu to Export Files

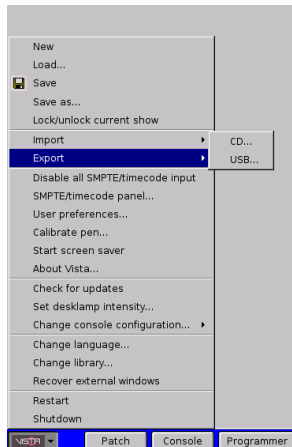

Vista will default to the "Data" directory.

If exporting the consoles diagnostics files, open the folder entitled "diagnostic files". Show files that are being archived are found in the "data" directory.


Vista will ask the user to select the files to be exported (See Figure 2)

Jands Vista Software Patch Release 1.13.5108 Patch Release Notes  
November 25, 2008

Jands Pty Ltd, 40 Kent Rd, Mascot, NSW, 2020, Australia  
Phone: +61 (2) 9582 0909 Fax: +61 (2) 9582 0999 Web: [www.jandsvista.com](http://www.jandsvista.com)


Page 7 of 9

**Figure 2 - Selecting Files to be Exported**

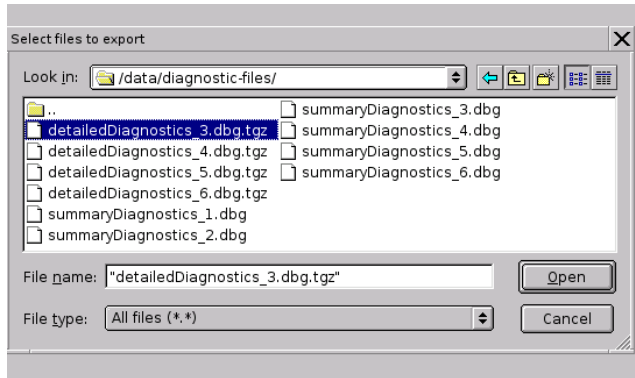

6. Once the files have been selected, Vista requires the user to select a destination directory. Vista will default to the USB drive if a USB device has been installed correctly.

**Figure 3 - Selecting Destination Directory**

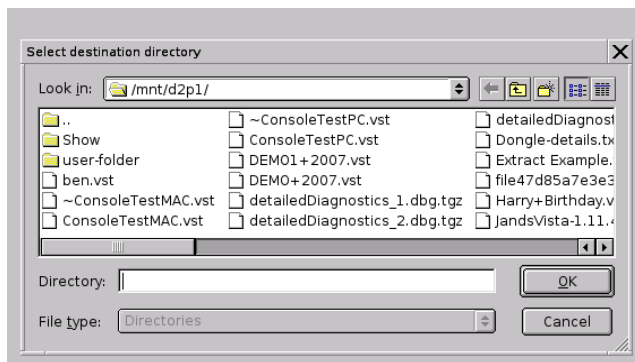

7. Press "OK" and once the files have been transferred, remove the USB drive.

Files are now ready for archiving or sending to another party.

## Archiving and Exporting Files via FTP Client

Jands recommends using a graphical FTP client such as FileZilla (<http://filezilla.sourceforge.net/>) to simplify the process.

*Note – This is a suggestion based on an internet search. Our suggestion should not be taken as endorsement of any one of these programs.*

The console must be connected to a network. Its IP address can be viewed and set through the Vista User Preferences dialog. Connection details:


- FTP server address: The IP address of your console.
- FTP username: vista-user
- FTP password: user

Jands Vista Software Patch Release 1.13.5108 Patch Release Notes  
November 25, 2008

Jands Pty Ltd, 40 Kent Rd, Mascot, NSW, 2020, Australia  
Phone: +61 (2) 9582 0909 Fax: +61 (2) 9582 0999 Web: [www.jandsvista.com](http://www.jandsvista.com)

Page 8 of 9

Figure 4 - FTP Client Menu

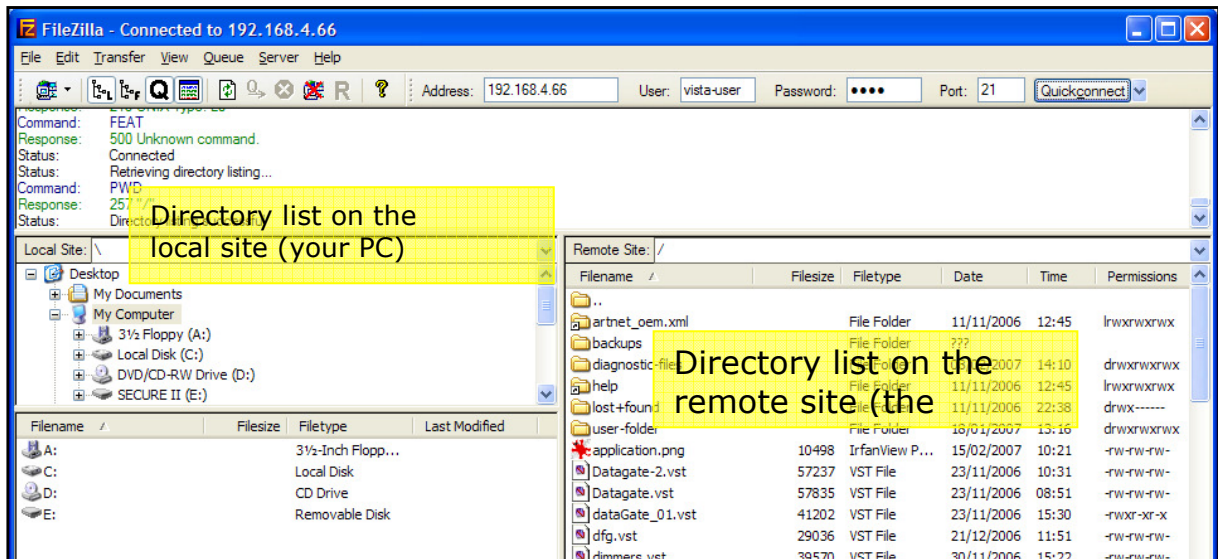

Vista will default to the "Data" menu on the console. Subfolders are also displayed and files can now be transferred to and from the Vista.

To transfer show files from the console to a PC, click on the desired show file on the remote site (the console) and drag them across to the local site (PC), placing them in the desired directory.